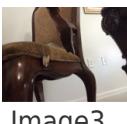
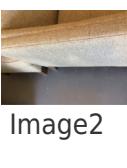
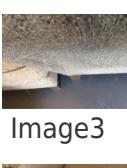
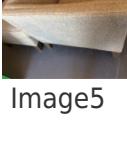


## Inspection/Final Report

<b>Client</b>	: Total Military Management	<b>Adjuster</b>	: Shirlyn Garzon
<b>Adjuster Ph</b>	:	<b>Date</b>	: Jul 29, 2021
<b>Received</b>		<b>Estatus Ref #</b>	: 631162
<b>GBL#</b>	: BKAS0122089	<b>Admin</b>	: Joe Lopez
<b>Valuations</b>	: FVP	<b>Additional Information</b>	:
<b>Shipper</b>	: DAVID FISHER	<b>Cell Ph</b>	:
<b>Home Ph</b>	: 808 349 8517	<b>E-Mail</b>	:
<b>Work Ph</b>	:		
<b>Address</b>	: 11754 SGT ALEXANDER KENADAY FORT BLISS, TX 79908		

## Items List

#	Photos	Item Description	Condition/ Recommendations/ Repairs	Costs
<b>SI No: 1</b> <b>Inv#: 133</b> <b>Wt: 0</b> <b>Ctn Avail:</b> No	    	Dining Room Chair	Dining room has left side wood armrest broken from bottom section.  Although there is some PED due to normal wear and tear, the damage claimed appears to be new.	<b>Est:</b> 100.00 <b>C/S:</b> 0.00 <b>Fee:</b> 0.00
			Probable damage cause - Improper handling.	Amount claimed \$150
			If liability is assumed, the estimate repair cost is \$100	
			Repairs require: pressure bonding, filling, sanding, color restoration, sheen duplication.	
<b>SI No: 2</b> <b>Inv#: 173</b> <b>Wt: 0</b> <b>Ctn Avail:</b> No		Trash Can	Item discarded prior to inspection.	<b>Est:</b> 0.00 <b>C/S:</b> 0.00 <b>Fee:</b> 0.00

<b>SI No:</b> 3			<b>Armoire</b>	Armoire has rear left leg trim broken off and missing. Front right leg has right side trim broken off and missing.	<b>Est:</b> 0.00 <b>C/S:</b> 100.00 <b>Fee:</b> 0.00
<b>Inv#:</b> 131/132	Image1	Image2			
<b>Wt:</b> 0					
<b>Ctn Avail:</b> No					
				Although there is some PED due to normal wear and tear, the damage claimed appears to be new.	
	Image3	Image4			
				Probable damage cause - Improper handling.	
	Image5	Image6			
				Amount claimed \$100	
	Image7				
				Repair cost exceeds amount claimed. Recommend cash settlement in amount claimed: \$	
<b>SI No:</b> 4			<b>Dresser</b>	Dresser has front top center broken and crack.	<b>Est:</b> 0.00 <b>C/S:</b> 0.00 <b>Fee:</b> 0.00
<b>Inv#:</b> 73/74	Image1	Image2			
<b>Wt:</b> 0					
<b>Ctn Avail:</b> No					
				Shipper repaired, Prior to inspection.	
	Image3	Image4			
				Amount claimed \$400	
	Image5				
<b>SI No:</b> 5			<b>End Table</b>	Item discarded prior to inspection.	<b>Est:</b> 0.00 <b>C/S:</b> 0.00 <b>Fee:</b> 0.00
<b>Inv#:</b> 179					
<b>Wt:</b> 0					
<b>Ctn Avail:</b> No					
<b>SI No:</b> 6			<b>Oversize Chair</b>	Oversize chair has right side frame support beam broken from rear corner.	<b>Est:</b> 200.00 <b>C/S:</b> 0.00 <b>Fee:</b> 0.00
<b>Inv#:</b> 121	Image1	Image2			
<b>Wt:</b> 0					
<b>Ctn Avail:</b> No					
				Although there is some PED due to normal wear and tear, the damage claimed appears to be new.	
	Image3	Image4			
				Probable damage cause - Improper handling.	
	Image5				
				Amount claimed \$300	

If liability is assumed, the estimate repair cost is \$200

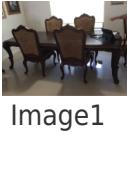
<b>SI No:</b> 7			Table Leaf	Table leaf #1 is rub from center and corners on decorative edges. Although there is some PED due to normal wear and tear, the damage claimed appears to be new.	<b>Est:</b> 25.00 <b>C/S:</b> 0.00 <b>Fee:</b> 0.00
<b>Inv#:</b> 201				Probable damage cause - Improper packing.	Amount claimed \$50
<b>Wt:</b> 0					If liability is assumed, the estimate repair cost is \$25
<b>Ctn Avail:</b> No				Repairs required fill, sanding, color match, and sheen duplication.	
<b>SI No:</b> 8			Table Leaf	Table leaf #2 is rub from center and corners on decorative edges. Although there is some PED due to normal wear and tear, the damage claimed appears to be new.	<b>Est:</b> 25.00 <b>C/S:</b> 0.00 <b>Fee:</b> 0.00
<b>Inv#:</b> 202				Probable damage cause - Improper packing.	Amount claimed \$50
<b>Wt:</b> 0					If liability is assumed, the estimate repair cost is \$25
<b>Ctn Avail:</b> No				Repairs required fill, sanding, color match, and sheen duplication.	
<b>SI No:</b> 9			Table	Dining table top is rub from center decorative edges and has all four corners are rub.	<b>Est:</b> 50.00 <b>C/S:</b> 0.00 <b>Fee:</b> 0.00
<b>Inv#:</b> 141/142				Although there is some PED due to normal wear and tear, the damage claimed appears to be new.	
<b>Wt:</b> 0					
<b>Ctn Avail:</b> No				Probable damage cause - Improper handling.	



Image5

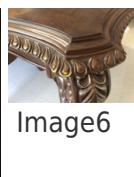


Image6

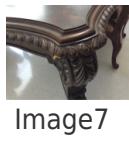


Image7

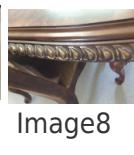


Image8

Amount claimed \$100

If liability is assumed, the estimate repair cost is \$50

Repairs required fill, sanding, color match, and sheen duplication.

**SI No:** 10**Inv#:** 139**Wt:** 0**Ctn Avail:**

No



Image1

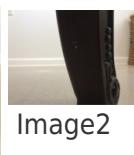


Image2

Table Leg

Table leg has small chip on inside center side.

**Est:** 25.00**C/S:** 0.00**Fee:** 0.00

Although there is some PED due to normal wear and tear, the damage claimed appears to be new.

Probable damage cause - Improper packing.

Amount claimed \$50

If liability is assumed, the estimate repair cost is \$25

Repairs required fill, sanding, color match, and sheen duplication.

**SI No:** 11**Inv#:** 140**Wt:** 0**Ctn Avail:**

No



Image1



Image2

Table Leg

Table leg has 1/2 chip on right side .

**Est:** 25.00**C/S:** 0.00**Fee:** 0.00

Although there is some PED due to normal wear and tear, the damage claimed appears to be new.

Probable damage cause - Improper packing.

Amount claimed \$50

If liability is assumed, the estimate repair cost is \$25

Repairs required fill, sanding, color match, and sheen duplication.

**SI No:** 12**Inv#:** 93**Wt:** 0**Ctn Avail:**

Buffet Table

Item discarded prior to inspection.

**Est:** 0.00**C/S:** 0.00**Fee:** 0.00

No

<b>SI No:</b> 13			Mirror	Vanity mirror is broken from bottom left corner.	<b>Est:</b> 0.00
<b>Inv#:</b> 292					<b>C/S:</b> 101.68
<b>Wt:</b> 0					<b>Fee:</b> 0.00
<b>Ctn Avail:</b> No	Image1	Image2		Although there is some PED due to normal wear and tear, the damage claimed appears to be new.	
				Probable damage cause - Improper packing.	
	Image3	Image4			Amount claimed \$600
				Item has no markings that would allow web research of confirmation of value.	
				If liability is assumed, the estimate replacement cost is \$101.68	
				<a href="https://www.amazon.com/dp/B07HVTBXMH/ref=redir_mobile_desktop?">https://www.amazon.com/dp/B07HVTBXMH/ref=redir_mobile_desktop?</a>	
<b>SI No:</b> 14			Picture frame	Item discarded prior to inspection.	<b>Est:</b> 0.00
<b>Inv#:</b> 217					<b>C/S:</b> 0.00
<b>Wt:</b>					<b>Fee:</b> 0.00
<b>Ctn Avail:</b> No					
<b>SI No:</b> 15			Hitachi Tv.	Tv original box has a hole on top right corner, Tv is broken from top right corner of screen.	<b>Est:</b> 0.00
<b>Inv#:</b> 233	Image1	Image2			<b>C/S:</b> 448.00
<b>Wt:</b> 0					<b>Fee:</b> 0.00
<b>Ctn Avail:</b> No					
				Although there is some PED due to normal wear and tear, the damage claimed appears to be new.	
	Image3	Image4			Probable damage cause - Improper handling.
					Amount claimed \$1,000
					If liability is assumed, the estimate replacement cost is \$448
					<a href="https://www.walmart.com/ip/Hisense-55-inch-4K-UHD-A6G-Series-Android-Smart-TV/24794100">https://www.walmart.com/ip/Hisense-55-inch-4K-UHD-A6G-Series-Android-Smart-TV/24794100</a>
					

## Inspection/Final Report

<b>Date of Report</b>	:	Aug 01, 2021	<b>Date Completed</b>	:	Jul 29, 2021
<b>Type of Report</b>	:	Inspection/Final Report	<b>Expenses</b>	:	\$ 0.00
<b>Inspection Fee</b>	:	\$ 225.00	<b>Tax</b>	:	\$ 15.19
<b>Total C/S</b>	:	\$ 649.68	<b>Total Est</b>	:	\$ 450.00
<b>Fees</b>	:	\$ 0.00	<b>Total</b>	:	\$ 240.19
<b>Additional information</b>	:				